执行MDS 9000系列交换机无中断NX-OS升级

目录

简介

背景信息

无中断升级概述

更新的MDS升级说明 — 适用于所有MDS平台

简介

本文档介绍在Cisco MDS 9000系列多层导向器交换机(MDS)上无中断升级NX-OS软件的说明。

背景信息

提示：有关本文档中介绍的过程的更多详细信息，请参阅Cisco MDS 9000 NX-OS和SAN-OS软件安装和升级指南。

无中断升级概述

此过程适用于开放系统和FICON MDS交换机。

所有MDS交换机均支持无中断升级和降级，这受Cisco MDS 9000 NX-OS和SAN-OS软件安装和升级指南中列出的限制所限制。请参阅MDS文档，包括版本说明:Cisco MDS 9000 - 9.x版本文档套件。

目标版本是在安装全部步骤中将MDS升级或降级到的NX-OS版本。最终目标版本是所需的最终版本的NX-OS版本。可能需要安装两个或多个这些中间目标版本才能达到最终目标版本。可以找到开放系统和FICON的无中断升级矩阵：Cisco MDS 9000 NX-OS软件和固件升级和降级指南，版本9.x。

这些版本已经修改，需要从9.4(1a)之前的NX-OS版本升级到高于9.4(1a)的最终目标NX-OS版本，并首次升级到NX-OS 9.4(1a)。 必须参阅Cisco MDS 9000 NX-OS软件和固件升级和降级指南了解详细信息。

在具有双管理引擎的97xx系列MDS上，在NX-OS安装期间，新映像将加载到备用Supervisor上。然后进行切换，使运行新代码的备用Supervisor处于活动状态。代码加载到以前的主用Supervisor上

，并成为新的备用Supervisor。数据平面继续通过光纤通道流量。然后，这些模块以无中断方式从编号最小的模块开始升级过程，并继续执行最高过程。

⚠ 警告：在升级之前，请查看一节中更新的最佳实践。

MDS 91xx、92xx或93xx系列交换矩阵交换机只有一个Supervisor。升级完成后，将以无中断方式重新加载管理引擎（控制平面）。数据平面继续在不中断的情况下传输光纤通道流量。

如果您打算通过Telnet、安全外壳(SSH)或简单网络管理协议(SNMP)（交换矩阵管理器/设备管理器）进行升级，请确保您已与两个管理引擎建立以太网连接。当Supervisor以无中断方式重新启动时，您的终端会话将丢失。您必须重新连接到交换机，并且必须连接到上一个备用Supervisor。

同一交换矩阵内的多个交换机可以同时升级。一旦交换矩阵中的所有交换机都升级，所有设备的功能都可在大约七天的时间内进行评估。如果未发现任何问题，则可以更新冗余交换矩阵中的交换机。

注意：思科建议从本地控制台完成NX-OS升级。

更新的MDS升级说明 — 适用于所有MDS平台

升级MDS 9000系列交换机的最佳实践已经更新，以确保使用ISSU时体验流畅。在运行install all kickstart之前…… 系统……命令，请严格遵循此步骤。

注意：目标版本是MDS在安装所有步骤中升级或降级到的NX-OS版本。最终目标版本是所需的最终版本NX-OS版本。可能需要安装两个或多个这些中间目标版本，才能达到最终目标版本。此过程可以重复用于每个中间目标版本和最终目标版本。

注意：验证支持到最终目标版本的无中断升级或降级路径。可以在Cisco MDS 9000 NX-OS软件和固件升级和降级指南9.x版中的支持Cisco MDS NX-OS软件无中断降级路径一章中找到该路径。

1.将Show Tech-Support Detail的副本另存为Gzipped文件。

其中包含当前交换机配置、日志文件和所有接口的状态。如果在升级期间或升级之后出现异常，则

了解升级之前的交换机状态有助于排除故障，并减少诊断任何问题的时间。在NX-OS版本8.4(2b)及更高版本中，可以使用tac-pac命令。在之前的版本中，可以使用show tech-support details命令：

```
mds9124V# tac-pac
Collecting show tech-support details...
Show tech details will take 4-8 minutes to complete. Please Wait ...
Collecting show logging onboard...
tacpac file volatile:mds9124V_tacpac_2025-08-22.gz created.
mds9124V#
```

2.将tac-pac/techsupport文件保存到交换机外部。

将保存的tac-pac/techsupport复制到TFTP服务器，将其重命名为“before_install”。 这样可以实现以下三点：

1. 它验证您是否有可操作的TFTP服务器。
2. 它验证您是否可以通过IP网络访问服务器。
3. 它将配置的副本放置在交换机的外部位置，因此您可以在交换机出现故障时进行备份。

```
MDS9124V# move volatile:F241-16-10-9124V-3_tacpac_2025-08-22.gz volatile:F241-16-10-9124V-3_tacpac_2025
MDS9124V# copy volatile: tftp:
<prompts for file name> mds9124V_tacpac_2025-08-22_before_install.gz
<prompts for tftp server name or ip address> 192.168.1.1
```



注意：在上一个示例中使用TFTP，MDS还支持FTP、SCP和SFTP。

3.（可选）保存交换机外部正在使用的当前映像。

验证您的TFTP服务器上有当前映像的副本，以便您具有备份（如果必须恢复为原始版本）。否则，请立即将其从交换机复制到TFTP服务器。要确定当前映像，请运行show version命令。请参阅以下示例：

```
MDS9124V# copy bootflash: tftp:
<prompts for file name> m9124v-s8ek9-kickstart-mz.9.3.2a.bin
<prompt for tftp server name or ip address> 192.168.1.1

MDS9148V# copy bootflash: tftp:
<prompts for file name> m9124v-s8ek9-mz.9.3.2a.bin
<prompt for tftp server name or ip address> 192.168.1.1
```

注意：对于提示文件名条目，请使用当前版本。

在上一个示例中，使用TFTP。MDS还支持FTP、SCP和SFTP。

4.下载目标系统并启动映像。

从思科软件下载下载下载新的NX-OS映像。您需要启动和系统映像。将它们放在TFTP服务器的默认TFTP目录中。


思科提供两种类型的NX-OS软件。Payload Non-Crypto，也称为Non-Payload Encryption(NPE)，版本适用于美国商务部列为包含加密的非出口软件列表的国家或政府。NPE版本中不包括某些高级故障排除功能。NPE版本还会限制思科提供变通方法或热修复的能力。只有符合出口限制的客户才能运行NPE版本。

下表可用于选择您的交换机系列和交换机软件映像：

Cisco MDS系列交换机类型	IBM MDS系列交换机类型	命名约定
MDS 9124V系列	SAN24C-7	文件名以m9124v-s8ek9开头
MDS 9132T系列	SAN32C-6	文件名以m9100-s6ek9开头
MDS 9148S系列	无	文件名以m9100-s5ek9开头
MDS 9148T系列	SAN48C-6	文件名以m9148-s6ek9开头
MDS 9148V系列	SAN48C-7	文件名以m9148v-s8ek9开头
MDS 9220i系列	SAN16C-R	文件名以m9220-s7ek9开头
MDS 9250i系列	SAN50C-R	文件名以m9250-s5ek9开头
MDS 9396S系列	无	文件名以m9300-s1ek9开头
MDS 9396T系列	SAN96C-6	文件名以m9300-s2ek9开头

MDS 9396V系列	SAN96C-7	文件名以m9396v-s3ek9开头
MDS 9710、9706和9718系列,Supervisor模块3	01FT600 SF1和01FT601 SF1E	文件名以m9700-sf3ek9开头
MDS 9710、9706和9718系列,Supervisor模块4	02JD753 SF4	文件名以m9700-sf4ek9开头

注意：在思科下载页面上，将鼠标悬停在文件名上以检索消息摘要5(MD5)。

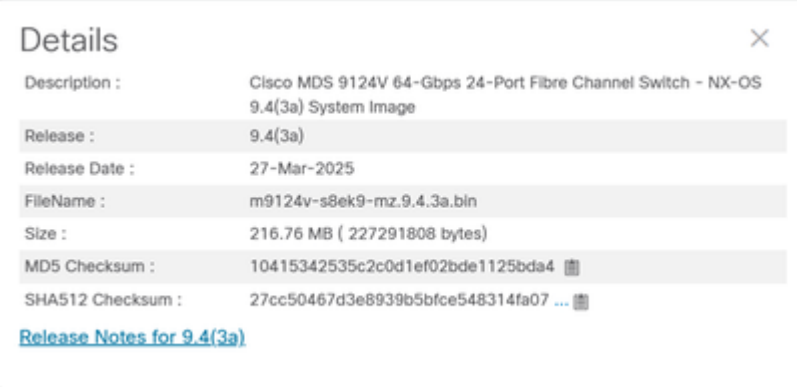

5.检验bootflash上是否有足够的可用空间来添加新的映像。

如果bootflash上的空间不足，无法容纳目标系统和启动映像，则必须至少擦除系统映像文件。保留kickstart映像，如果发生故障，您可以将交换机引导至可以加载(TFTP)新映像的位置。升级后，您可以删除旧版本。

注意：无法删除当前映像。

运行dir命令以检查可用的bootflash可用空间：

```
MDS9124V# dir bootflash:
```

如果运行双Supervisor MDS 9700交换机，请运行以下命令检查备用Supervisor上是否有足够的可用空间：

```
MDS9700# dir bootflash://sup-standby/
```

6.从TFTP服务器将新映像下载到交换机上的bootflash。

```
MDS9124V# copy tftp: bootflash:
<prompts for file name> m9124v-s8ek9-kickstart-mz.9.4.3a.bin
<prompt for tftp server name or ip address> 192.168.1.1

MDS9124V# copy tftp: bootflash:
<prompts for file name> m9124v-s8ek9-mz.9.4.3a.bin
<prompt for tftp server name or ip address> 192.168.1.1
```



注意：在上一个示例中，使用TFTP。MDS还支持FTP、SCP和SFTP。

验证校验和，并验证MD5校验和：

有效的MD5校验和示例：

```
MDS9124V# show version image m9124v-s8ek9-mz.9.4.3a.bin
MD5 Verification Passed
image name: m9124v-s8ek9-mz.9.4.3a.bin
bios: v1.11.0(11/27/2024)
system: version 9.4(3a)
compiled: 3/1/2025 12:00:00 [03/25/2025 00:13:28]
MDS9124V#
```

无效的MD5校验和示例，必须重新下载。

```
MDS9124V# show version image m9124v-s8ek9-mz.9.4.3a.bin
MD5 Verification Failed
Image integrity check failed
```

如果要升级的MDS是9700系列，请将启动映像和系统映像复制到备用Supervisor上的bootflash:

```
mds-9706# copy bootflash:m9700-sf4ek9-kickstart-mz.9.4.4.bin bootflash://sup-standby/
Copy progress 100% 80165KB
Copy complete, now saving to disk (please wait)...
mds-9706# copy bootflash:m9700-sf4ek9-mz.9.4.4.bin bootflash://sup-standby/
Copy progress 100% 542544KB
```

```
Copy complete, now saving to disk (please wait)...
mds-9706#
```

7.保存SAN分析配置并暂时禁用SAN分析功能。

如果a和b都为true，则必须完成此步骤：

a. 已启用SAN分析。
b. 交换机型号为以下其中一项：
    1. MDS 9700交换机，包含一个或多个32 Gbps模块“4/8/16/32 Gbps高级FC模块DS-X9648-1536K9”或
    2. 交换机型号为MDS 9132T、MDS 9148T或MDS 9396T。

注意：对于IBM品牌9700交换机，“4/8/16/32 Gbps高级FC模块”的IBM型号是01FT644。

当无中断升级路径包括到最终目标版本的多个升级时，此步骤只能在第一个NX-OS升级时完成。

这是由于启用分析并完成NX-OS升级时，可能会导致TCAM损坏的问题。升级完成后，在第15步中重新启用分析。如果show feature命令显示分析已禁用，则可以跳过此步骤和步骤14。此问题记录在思科漏洞ID CSCwo03706中.

此命令显示插槽12中的32 Gbps模块是MDS 9718:

```
MDS9718# show module
Mod  Ports  Module-Type                          Model              Status
---  -----  ----------------------------------- ------------------ ----------
1    48     2/4/8/10/16 Gbps Advanced FC Module DS-X9448-768K9     ok
4    48     2/4/8/10/16 Gbps Advanced FC Module DS-X9448-768K9     ok
9    0      Supervisor Module-4                 DS-X97-SF4-K9      ha-standby
10   0      Supervisor Module-4                 DS-X97-SF4-K9      active *
11   34     1/10/40G IPS,2/4/8/10/16G FC Module DS-X9334-K9        ok
12   48     4/8/16/32 Gbps Advanced FC Module   DS-X9648-1536K9    ok
13   48     8/16/32/64 Gbps Advanced FC Module  DS-X9748-3072K9    ok
```

此命令显示IBM品牌SAN192C(9706)的插槽12中的32 Gbps模块：

```
 SAN192C# show module
Mod  Ports  Module-Type                          Model              Status
---  -----  ----------------------------------- ------------------ ----------
1    48     4/8/16/32 Gbps Advanced FC Module   01FT644 48x32 FC   ok
2    48     8/16/32/64 Gbps Advanced FC Module  03FR076 48x64 FC   ok
3    0      Supervisor Module-4                 02JD753 SF4        active *
```

```
4    0      Supervisor Module-4                 02JD753 SF4        ha-standby
5    34     1/10/40G IPS,2/4/8/10/16G FC Module 01FT645 24/10 EX   ok
6    48     8/16/32/64 Gbps Advanced FC Module  03FR076 48x64 FC   ok
```

此命令显示交换机类型为9148T:

```
MDS9148T# show version
Cisco Nexus Operating System (NX-OS) Software
TAC support: http://www.cisco.com/tac
Documents: http://www.cisco.com/en/US/products/ps9372/tsd_products_support_serie
s_home.html
Copyright (c) 2002-2025, Cisco Systems, Inc. All rights reserved.
The copyrights to certain works contained herein are owned by
other third parties and are used and distributed under license.
Some parts of this software are covered under the GNU Public
License. A copy of the license is available at
http://www.gnu.org/licenses/gpl.html.

Software
  BIOS:      version 1.11.0
  loader:    version N/A
  kickstart: version 9.4(3b)
  system:    version 9.4(3b)
  BIOS compile time:       11/27/2024
  kickstart image file is: bootflash:///m9148-s6ek9-kickstart-mz.9.4.3b.bin
  kickstart compile time:  5/24/2025 12:00:00 [05/28/2025 12:25:54]
  system image file is:    bootflash:///m9148-s6ek9-mz.9.4.3b.bin
  system compile time:     5/24/2025 12:00:00 [05/28/2025 13:58:43]


Hardware
  cisco MDS 9148T 48X32G FC (1 RU) Chassis ("4/8/16/32 Gbps FC/Sup-4")
  Intel(R) Xeon(R) CPU D-1530 @ 2.40GHz with 5735444 kB of memory.
  Processor Board ID JAE22500MUN

  Device name: F241-14-08-9148T-2
  bootflash:    3735552 kB

Kernel uptime is 8 day(s), 1 hour(s), 27 minute(s), 47 second(s)

Last reset at 462831 usecs after Thu Aug 14 19:44:56 2025
  Reason: Reset due to upgrade
  System version: 8.4(2d)
  Service:

plugin
  Core Plugin
MDS9148T#
```

此命令显示已启用功能分析：

```
MDS9718# show feature | i analytics
analytics          1        enabled
```

如果启用SAN Analytics，请将SAN Analytics配置副本保存到两个管理引擎：

```
MDS9718# echo "configure terminal" > before_issu_analytics.cfg
MDS9718# show running-config analytics >> before_issu_analytics.cfg
```

如果这是MDS 9700或IBM品牌9700，请将分析配置复制到备用Supervisor:

```
MDS9718# copy before_issu_analytics.cfg bootflash://sup-standby/
```

暂时禁用SAN Analytics功能：

```
MDS9718# configure terminal
MDS9718(config)# no feature analytics
MDS9718(config)# end
MDS9718# copy running-config startup-config
```

8.执行系统切换（仅限MDS 9700）。

如果交换机型号是MDS 9700交换机，则必须完成此步骤。

从活动Supervisor运行system switchover命令。系统切换完成后，重新连接新激活的Supervisor，并等待备用Supervisor达到“ha-standby”状态。

以下是从活动Supervisor上的控制台连接执行system switchover命令的示例：

```
MDS9710# system switchover
MDS9710#
User Access Verification
MDS9710 login: [703536.990233]  writing reset reason 7,

ME Firmware Status #1: 0x000F0345
ME Firmware Status #2: 0x38000000
ME Current State: Operational
ME Error Code: No Error
ME Operational Firmware Version: 06:3.0.3.214

  CPU Signature - 0x00050663: Version - 0x00050660
  CPU - 1 : Cores - 8 : HTEn - 1 : HT - 2 : Features - 0xBFEBFBFF
  MicroCode Version : 0x0700001E
```

```
...etc...
```

重新连接到新激活的Supervisor并运行show module命令。一旦管理引擎进入“ha-standby”状态，此步骤即完成：

```
MDS9710# show module
Mod  Ports  Module-Type                          Model              Status
---  -----  ---------------------------------- ------------------ ----------
1    48     2/4/8/10/16 Gbps Advanced FC Module DS-X9448-768K9     ok
4    48     2/4/8/10/16 Gbps Advanced FC Module DS-X9448-768K9     ok
5    0      Supervisor Module-4                                    powered-up
6    0      Supervisor Module-4                 DS-X97-SF4-K9      active *
8    34     1/10/40G IPS,2/4/8/10/16G FC Module DS-X9334-K9        ok
9    48     4/8/16/32 Gbps Advanced FC Module   DS-X9648-1536K9    ok
10   48     8/16/32/64 Gbps Advanced FC Module  DS-X9748-3072K9    ok
...

MDS9710# show module
Mod  Ports  Module-Type                          Model              Status
---  -----  ---------------------------------- ------------------ ----------
1    48     2/4/8/10/16 Gbps Advanced FC Module DS-X9448-768K9     ok
4    48     2/4/8/10/16 Gbps Advanced FC Module DS-X9448-768K9     ok
5    0      Supervisor Module-4                 DS-X97-SF4-K9      ha-standby
6    0      Supervisor Module-4                 DS-X97-SF4-K9      active *
8    34     1/10/40G IPS,2/4/8/10/16G FC Module DS-X9334-K9        ok
9    48     4/8/16/32 Gbps Advanced FC Module   DS-X9648-1536K9    ok
10   48     8/16/32/64 Gbps Advanced FC Module  DS-X9748-3072K9    ok
...
```

9.检查NX-OS版本之间的不兼容。

运行show incompatibility system<target system image name>命令，检查NX-OS版本之间的不兼容性以及可能阻止升级的任何交换机事件。这还可以确保/var/volatile/tmp文件系统有足够的空间继续运行。以下是一个示例：

```
MDS9124V# show incompatibility system m9124v-s8ek9-mz.9.4.3a.bin
Checking incompatible configuration(s):
No incompatible configurations

Checking dynamic incompatibilities:
No incompatible configurations
MDS9124V#
```

10.确定对安装的任何影响。

这将检查映像并确保它们与交换机兼容。它还指示映像中是否包含BIOS升级。此操作通过show

install all impact命令完成：

```
MDS9124V# show install all impact system m9124v-s8ek9-mz.9.4.3a.bin kickstart m9124v-s8ek9-kickstart-mz
Installer will perform impact only check. Please wait.

Verifying image bootflash:/m9124v-s8ek9-kickstart-mz.9.4.3a.bin for boot variable "kickstart".
[####################] 100% -- SUCCESS

Verifying image bootflash:/m9124v-s8ek9-mz.9.4.3a.bin for boot variable "system".
[####################] 100% -- SUCCESS

Performing module support checks.                                            [####################

Verifying image type.
[####################] 100% -- SUCCESS

Extracting "system" version from image bootflash:/m9124v-s8ek9-mz.9.4.3a.bin.
[####################] 100% -- SUCCESS

Extracting "kickstart" version from image bootflash:/m9124v-s8ek9-kickstart-mz.9.4.3a.bin.
[####################] 100% -- SUCCESS

Extracting "bios" version from image bootflash:/m9124v-s8ek9-mz.9.4.3a.bin.
[####################] 100% -- SUCCESS

Performing Compact Flash and TCAM sanity test.
[####################] 100% -- SUCCESS

Notifying services about system upgrade.                                     [####################



Compatibility check is done:
Module  bootable          Impact  Install-type  Reason
------  --------  --------------  ------------  ------
     1       yes  non-disruptive         reset


Images will be upgraded according to following table:
Module       Image                  Running-Version(pri:alt)           New-Version  Upg-Required
------  ----------  ----------------------------------------  --------------------  ------------
     1      system                                    9.3(2a)               9.4(3a)           yes
     1   kickstart                                    9.3(2a)               9.4(3a)           yes
     1        bios   v1.11.0(11/27/2024):v1.11.0(11/27/2024)   v1.11.0(11/27/2024)            no


MDS9124V#
```



注意：此命令必须作为单行输入，而不是作为两行输入。此命令不用于安装，但是，它可用于验证安装过程，并提供显示来自和即将到来的版本的报告。在执行升级时，它还会显示升级是中断性还是非中断性。

注意：在开始升级/降级过程之前，必须关闭到交换机的所有文件传输会话（如SFTP/SCP）。任何打开的文件传输会话都可能导致交换机在ISSU/D时中断地重新加载。

有关详细信息，请参阅Cisco Bug ID CSCvo2269和Cisco Bug ID CSCvu52058。客户端抱怨在打开SSH会话时MobaXterm会打开SFTP会话，从而阻止升级的发生。

注意：32 Gbps交换矩阵交换机的具体准则：

- 从NX-OS 9.4(5)开始，升级到任何更高的NX-OS版本时，激活32 Gbps交换矩阵交换机上的Supervisor CPU BIOS更新的机制已更改。默认情况下，BIOS更新是安装的，但是CPU不会加载，除非交换机被中断地重新加载。ISSU install all命令已通过disruptive选项得到增强，以允许在ISSU结束时自动执行中断性重新加载。或者，可以在ISSU之后使用reload命令完成中断性重新加载，作为以后单独的操作。请勿使用reload system non-disruptive命令。要确定升级是否也包含BIOS升级，请检查show install all impact命令的输出。
- 对于运行低于NX-OS 9.4(5)的NX-OS版本的32 Gbps交换矩阵交换机，在ISSU期间激活Supervisor CPU BIOS的机制不可靠。仅当新的NX-OS版本包含BIOS更新时，才能在升级之前使用hidden install module 1 bios system newNxosSystemImage命令安装新NX-OS中的BIOS。然后，可使用reload CLI命令中断地重新加载交换机。请勿使用reload system non-disruptive命令。随后，NX-OS的ISSU可以无中断地执行，因为ISSU可以检测到BIOS已升级。
- 有关详细信息，请参阅步骤12和步骤14。

注意：64 Gbps交换矩阵交换机的具体准则：

激活64 Gbps交换矩阵交换机上的BIOS更新的机制已更改。在首次升级到NX-OS 9.4(5)或更高版本后，建议也升级交换机EPLD。此EPLD包含新功能，允许交换机的CPU独立重新通电，同时仍保持无中断流量转发。所有EPLD升级都会中断，因为交换机作为EPLD升级的一部分重新加载。在首次升级到NX-OS 9.4(5)或更高版本后，此操作只能完成一次。

有关详细信息，请参阅步骤14。

11.验证tmp文件目录的使用率是否不超过9%。

某些MDS交换机使用/var/volatile/tmp目录，而其它交换机使用/var/tmp目录。运行show system internal flash | inc "/var/tmp|/var/volatile/tmp"命令，检查以下两个命令上的可用空间：

```
MDS9124V# show  system internal flash | inc "/var/tmp|/var/volatile/tmp"
```

```
Mount-on                  1K-blocks      Used    Available   Use%  Filesystem
/var/volatile/tmp            614400       104       614296      1   none

MDS9124V#
```

注意：上一个示例显示文件系统已使用1%，因此可以安全地继续下一步。如果/var/volatile/tmp目录或/var/tmp目录的使用率超过9%，请不要继续安装，并与Cisco TAC联系。

12.从新系统映像升级管理引擎BIOS。

每种特定类型的硬件都有自己的BIOS版本。具体硬件类型（如管理引擎、交换模块等）不同，编号也大不相同。如果步骤10中show install all impact命令的输出表明目标版本中存在BIOS升级，请继续执行这些步骤。

注意：NX-OS 9.4(2)中引入了一个新的管理引擎BIOS，用于CVE-2024-20397。

当当前交换机NX-OS版本介于8.4(2)和9.3(2a)之间，而目标NX-OS版本为9.4(2)或更高时，此程序适用于所有交换机型号。它还适用于运行低于NX-OS 9.4(5)的NX-OS版本的32 Gbps交换矩阵交换机。 在继续这些步骤之前，确保NX-OS映像已复制到管理引擎。

1. 在运行hidden命令的每个Supervisor上手动安装最新的Supervisor BIOS:install module module_number bios system newNxosSystemImage。在具有双管理引擎的MDS 9700上，必须在每个管理引擎上执行此操作。对于MDS交换矩阵交换机，模块编号始终为1。在交换矩阵交换机上，可以在BIOS升级完成后重新加载交换机。此操作通过reload命令完成。在本示例中，从MDS 9124V交换矩阵交换机上的9.4(3a)系统映像升级BIOS:

```
MDS9124V# install module 1 bios system m9124v-s8ek9-mz.9.4.3a.bin
Collecting bios version from module 1 and system image. This may take a while.
Warning: Please do not remove or power off the module at this time
Upgrading primary bios
Started bios programming .... please wait
[############################100%##############################]
BIOS install succeeded for module 1
Upgrading alternate bios
Started bios programming .... please wait
[############################100%##############################]
BIOS install succeeded for module 1
MDS9124V#
MDS9124V# reload
This command will reboot the system. (y/n)?  [n] y
2026 May 14 18:20:00 MDS9124V %PLATFORM-2-PFM_SYSTEM_RESET: Manual system restart from Command Line Int
...
```

在本示例中，插槽9和10中具有管理引擎的MDS 9718中的BIOS正在升级到9.4(2a):

```
MDS9718# show module | include Supervisor
9    0      Supervisor Module-4                DS-X97-SF4-K9     active *
10   0      Supervisor Module-4                DS-X97-SF4-K9     ha-standby
MDS9718#
MDS9718# install module 9 bios system m9700-sf4ek9-mz.9.4.2a.bin
Collecting bios version from module 1 and system image. This may take a while.
Warning: Please do not remove or power off the module at this time
Upgrading primary bios
Started bios programming .... please wait
[############################100%##############################]
BIOS install succeeded for module 9
Upgrading alternate bios
Started bios programming .... please wait
[############################100%##############################]
BIOS install succeeded for module 9
MDS9718#
MDS9718# install module 10 bios system m9700-sf4ek9-mz.9.4.2a.bin
Collecting bios version from module 1 and system image. This may take a while.
Warning: Please do not remove or power off the module at this time
Upgrading primary bios
Started bios programming .... please wait
[############################100%##############################]
BIOS install succeeded for module 10
Upgrading alternate bios
Started bios programming .... please wait
[############################100%##############################]
BIOS install succeeded for module 10
MDS9718#
```

13.升级交换机上的NX-OS。

继续升级到运行“install all”命令的新版本NX-OS:

以下是MDS 9124V升级到NX-OS 9.4(4)的示例：

```
MDS9124V# install all kickstart m9124v-s8ek9-kickstart-mz.9.4.4.bin system m9124v-s8ek9-mz.9.4.4.bin
Installer will perform compatibility check first. Please wait.

Verifying image bootflash:/m9124v-s8ek9-kickstart-mz.9.4.4.bin for boot variable "kickstart".
[####################] 100% -- SUCCESS

Verifying image bootflash:/m9124v-s8ek9-mz.9.4.4.bin for boot variable "system".
[####################] 100% -- SUCCESS

Performing module support checks.

Verifying image type.
[####################] 100% -- SUCCESS
```

```
Extracting "system" version from image bootflash:/m9124v-s8ek9-mz.9.4.4.bin.
[####################] 100% -- SUCCESS

Extracting "kickstart" version from image bootflash:/m9124v-s8ek9-kickstart-mz.9.4.4.bin.
[####################] 100% -- SUCCESS

Extracting "bios" version from image bootflash:/m9124v-s8ek9-mz.9.4.4.bin.
[####################] 100% -- SUCCESS

Performing Compact Flash and TCAM sanity test.
[####################] 100% -- SUCCESS

Notifying services about system upgrade.



Compatibility check is done:
Module  bootable          Impact  Install-type  Reason
------  --------  --------------  ------------  ------
     1       yes  non-disruptive         reset



Images will be upgraded according to following table:
Module       Image                  Running-Version(pri:alt)           New-Version  Upg-Required
------  ----------  ---------------------------------------  --------------------  ------------
     1      system                                 9.4(1a)                9.4(4)           yes
     1   kickstart                                 9.4(1a)                9.4(4)           yes
     1        bios   v1.11.0(11/27/2024):v1.11.0(11/27/2024)   v1.11.0(11/27/2024)            no


Do you want to continue with the installation (y/n)?  [n] y

Install is in progress, please wait.

Performing runtime checks.

Notifying services about the upgrade.

Setting boot variables.
[####################] 100% -- SUCCESS

Performing configuration copy.
[####################] 100% -- SUCCESS

Module 1: Refreshing compact flash and Upgrading bios/loader/bootrom/power-seq.
Warning: please do not remove or power off the module at this time.
[####################] 100% -- SUCCESS

Upgrade can no longer be aborted, any failure will result in a disruptive upgrade.

Freeing memory in the file system.

Loading images into memory.

Saving linecard runtime state.

Saving supervisor runtime state.

Saving mts state.

Reloading the kernel to proceed with the upgrade.
```

```
All telnet and ssh connections will now be temporarily terminated.
F241-16-11-9124V-1#

MDS BIOS: v1.11.0 Date: 11/27/2024 15:45:42
System Date: 08/27/2025  Time: 18:43:44.0
Booting bootflash:/m9124v-s8ek9-kickstart-mz.9.4.4.bin
Trying diskboot
 Filesystem type is ext2fs, partition type msdos.
Image SWID valid
Image MD5Sum match
OS Image Key Type: Development KEY


Image Signature verification was Successful.

Boot Time: 8/27/2025  18:43:51
INIT: version 2.88 booting
USB device found..

boot device node /dev/sda
obfl flash device node /dev/sdb
Checking obfl filesystem. done.
Checking all filesystems.... done.
ACT2: ACT2 AUTHENTICATION TEST STATUS : SUCCESS
/etc/rc.d/rcS.d/S81mcelog-init: line 33: boot_debug: command not found
Starting mcelog daemon
Loading system software
isanimg_passed_by_sycli::
System image digital signature verification successful.
Uncompressing system image: bootflash:/m9124v-s8ek9-mz.9.4.4.bin Wed Aug 27 18:44:37 UTC 2025
blogger: nothing to do.
CCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCC
..done Wed Aug 27 18:44:39 UTC 2025
INIT: Entering runlevel: 3
starting statd: done
2025 Aug 27 18:44:50 F241-16-11-9124V-1 %SYSLOG-2-SYSTEM_MSG : Syslogs wont be logged into logflash unt
2025 Aug 27 18:44:53 F241-16-11-9124V-1 %KERN-2-SYSTEM_MSG: [   14.911303] igb_probe: Could not do igb_
2025 Aug 27 18:45:10 F241-16-11-9124V-1 %CARDCLIENT-2-REG: OK
2025 Aug 27 18:45:17 F241-16-11-9124V-1 %PMON-SLOT1-2-PMON_CRIT_INFO: Port Monitor Critical Information
2025 Aug 27 18:45:19 F241-16-11-9124V-1 %PLATFORM-2-PS_DETECT: Power supply 1 detected but shutdown (Se
2025 Aug 27 18:45:19 F241-16-11-9124V-1 %PLATFORM-2-PS_OK: Power supply 2 ok(Serial number LIT24512HSG)
2025 Aug 27 18:45:19 F241-16-11-9124V-1 %PLATFORM-2-PS_FANOK: Fan in Power supply 2 ok

User Access Verification

Continuing with installation process, please wait.
The login will be disabled until the installation is completed.

Status for linecard upgrade.

Performing supervisor state verification.

Supervisor non-disruptive upgrade successful.

Install has been successful.
```

以下是MDS 9710升级到NX-OS 9.4(3a)的示例：

```
MDS9710# install all kickstart m9700-sf4ek9-kickstart-mz.9.4.3a.bin system m9700-sf4ek9-mz.9.4.3a.bin
Installer will perform compatibility check first. Please wait.

Verifying image bootflash:/m9700-sf4ek9-kickstart-mz.9.4.3a.bin for boot variable "kickstart".
[####################] 100% -- SUCCESS

Verifying image bootflash:/m9700-sf4ek9-mz.9.4.3a.bin for boot variable "system".
[####################] 100% -- SUCCESS

Performing module support checks. [####################] 100% -- SUCCESS

Verifying image type.
[####################] 100% -- SUCCESS

Extracting "slc4xb" version from image bootflash:/m9700-sf4ek9-mz.9.4.3a.bin.
[####################] 100% -- SUCCESS

Extracting "bios" version from image bootflash:/m9700-sf4ek9-mz.9.4.3a.bin.
[####################] 100% -- SUCCESS

Extracting "system" version from image bootflash:/m9700-sf4ek9-mz.9.4.3a.bin.
[####################] 100% -- SUCCESS

Extracting "kickstart" version from image bootflash:/m9700-sf4ek9-kickstart-mz.9.4.3a.bin.
[####################] 100% -- SUCCESS

Extracting "lctsh" version from image bootflash:/m9700-sf4ek9-mz.9.4.3a.bin.
[####################] 100% -- SUCCESS

Extracting "slcf32" version from image bootflash:/m9700-sf4ek9-mz.9.4.3a.bin.
[####################] 100% -- SUCCESS

Extracting "slc-hindon" version from image bootflash:/m9700-sf4ek9-mz.9.4.3a.bin.
[####################] 100% -- SUCCESS

Notifying services about system upgrade. [####################] 100% -- SUCCESS



Compatibility check is done:
Module bootable Impact Install-type Reason
------ -------- -------------- ------------ ------
1 yes non-disruptive rolling
4 yes non-disruptive rolling
5 yes non-disruptive reset
6 yes non-disruptive reset
8 yes non-disruptive rolling
9 yes non-disruptive rolling
10 yes non-disruptive rolling


Other miscellaneous information for installation:
Module info
------ ---------------------------------
8 FC ports 1-24 are hitless, IPS 1-8 are hitful, and Intelligent Applications running are hitful


Images will be upgraded according to following table:
Module Image Running-Version(pri:alt) New-Version Upg-Required
------ ---------- ------------------------------------ -------------------- ------------
1 slc4xb 9.4(2a) 9.4(3a) yes
```

```
1 bios v1.10.23(04/07/20):v1.10.23(04/07/20) v1.10.23(04/07/20) no
4 slc4xb 9.4(2a) 9.4(3a) yes
4 bios v1.10.23(04/07/20):v1.10.23(04/07/20) v1.10.23(04/07/20) no
5 system 9.4(2a) 9.4(3a) yes
5 kickstart 9.4(2a) 9.4(3a) yes
5 bios v2.21.0(11/27/2024):v2.21.0(11/27/2024) v2.21.0(11/27/2024) no
6 system 9.4(2a) 9.4(3a) yes
6 kickstart 9.4(2a) 9.4(3a) yes
6 bios v2.21.0(11/27/2024):v2.21.0(11/27/2024) v2.21.0(11/27/2024) no
8 lctsh 9.4(2a) 9.4(3a) yes
8 bios v4.2.19(05/16/2023):v4.2.19(05/16/2023) v4.2.19(05/16/2023) no
9 slcf32 9.4(2a) 9.4(3a) yes
9 bios v4.1.56(05/16/2023):v4.1.56(05/16/2023) v4.1.56(05/16/2023) no
10 slc-hindon 9.4(2a) 9.4(3a) yes
10 bios v1.11.0(11/27/2024):v1.11.0(11/27/2024) v1.11.0(11/27/2024) no


Do you want to continue with the installation (y/n)? [n] y

Install is in progress, please wait.

Performing runtime checks. [####################] 100% -- SUCCESS

Syncing image bootflash:/m9700-sf4ek9-kickstart-mz.9.4.3a.bin to standby.
[####################] 100% -- SUCCESS

Syncing image bootflash:/m9700-sf4ek9-mz.9.4.3a.bin to standby.
[####################] 100% -- SUCCESS

Setting boot variables.
[####################] 100% -- SUCCESS

Performing configuration copy.
[####################] 100% -- SUCCESS

Module 1: Upgrading bios/loader/bootrom/power-seq.
Warning: please do not remove or power off the module at this time.
[####################] 100% -- SUCCESS

Module 4: Upgrading bios/loader/bootrom/power-seq.
Warning: please do not remove or power off the module at this time.
[####################] 100% -- SUCCESS

Module 5: Upgrading bios/loader/bootrom/power-seq.
Warning: please do not remove or power off the module at this time.
[####################] 100% -- SUCCESS

Module 6: Upgrading bios/loader/bootrom/power-seq.
Warning: please do not remove or power off the module at this time.
[####################] 100% -- SUCCESS

Module 8: Upgrading bios/loader/bootrom/power-seq.
Warning: please do not remove or power off the module at this time.
[####################] 100% -- SUCCESS

Module 9: Upgrading bios/loader/bootrom/power-seq.
Warning: please do not remove or power off the module at this time.
[####################] 100% -- SUCCESS

Module 10: Upgrading bios/loader/bootrom/power-seq.
Warning: please do not remove or power off the module at this time.
[####################] 100% -- SUCCESS
```

```
ME Firmware Status #1: 0x000F0345
ME Firmware Status #2: 0x3800E000
ME Current State: Operational
ME Error Code: No Error
ME Operational Firmware Version: 06:3.0.3.214

CPU Signature - 0x00050663: Version - 0x00050660
CPU - 1 : Cores - 8 : HTEn - 1 : HT - 2 : Features - 0xBFEBFBFF
MicroCode Version : 0x0700001E

Banzai FPGA Information:
BANZAI BusNum 3B Tornado VenID = 0x1137 DevId = 0x141 PCI address 0xF800000C
BANZAI FPGA BusNum 3C VenID = 0x10EE DevId = 0x7 PCI address 0xBC000000
BANZAI LPC VenID = 0x8086 DevId = 0x8C54
Revison Number = 0x14
BIOS = Primary 0x200

Primary SB_Result: 0x18C3140
SB_Address: 0xFFDE008C
SB_Error: 0x0

Secondary SB_Result: 0x0
SB_Address: 0x0
SB_Error: 0x0

Enable OS Watchdog timer. Value 0x7FC00
Punch SPI boot timer Stop. Value 0x300
IOFPGA MISC RESET REG 0x18. Default Value 0x0
IOFPGA MISC RESET REG 0x18. Value 0x400
Config S2S Command register 0x704. Value 0x4
Config S2S Config register 0x700. Value 0x800000F
IDROM MAC Address = 10:B3:D6:8E:19:04

Disable GBE ASPM

SATA Port 0: Micron_5100_MT - 240.0 GB

NEXUS OS Boot Mode = 0x0

Selected Boot Option:
NEXUS OS: GRUB Boot

CISCO SUP3DC3X BIOS: v2.21.0 Date: 11/27/2024 12:29:13

Pre OS Boot Entry:

IO-FPGA: Disabled OS Watch Dog Timer!

PMB2_REG(0x8)=0xaa

S2S_REG(0x24)=0x1
Booting bootflash:/m9700-sf4ek9-kickstart-mz.9.4.3a.bin
Trying diskboot
Filesystem type is ext2fs, partition type 0x83
Image SWID valid


Image Signature verification was Successful.

Boot Time: 8/27/2025 12:41:37
```

```
Cisco OS Boot Entry:

IO-FPGA: Enabled the OS Watch Dog Timer!
INIT: version 2.88 booting
Checking Bootflash
Bootflash firmware upgrade not required
Checking SSD
Checking firmware version for SSD
Firmware is already at latest version


OBFL device found as /dev/sda
usb device (2-1:1.0) /dev/sdb found after 0 iterations
boot device node /dev/sdb
cat: /sys/bus/usb/devices/1-1.1/dev: No such file or directory
mknod: invalid minor device number ''
Checking obfl filesystems...[ 35.469121] OBFL Error: (line 1265):obfl_global_header_check: number of bl

Checking all filesystems..r.r.r.R.r done.
[ 59.398556] SUP booted with primary IO-FPGA
[ 59.448706] in cctrl2 module
[ 59.483190] registering callback
Starting mcelog daemon
Starting rpcbind daemon...done.
creating NFS state directory: done
starting 8 nfsd kernel threads: done
starting mountd: done
starting statd: done
Loading system software
/bootflash//m9700-sf4ek9-mz.9.4.3a.bin read done
System image digital signature verification successful.
Uncompressing system image: bootflash:/m9700-sf4ek9-mz.9.4.3a.bin Wed Aug 27 12:43:13 UTC 2025
blogger: nothing to do.
C
..done Wed Aug 27 12:43:19 UTC 2025
INIT: Entering runlevel: 3
System is coming up ... Please wait ...
System is coming up ... Please wait ...
System is coming up ... Please wait ...
System is coming up ... Please wait ...
System is coming up ... Please wait ...
System is coming up ... Please wait ...
System is coming up ... Please wait ...
System is coming up ... Please wait ...
System is coming up ... Please wait ...
System is coming up ... Please wait ...

User Access Verification

Continuing with installation, please wait
2025 Aug 27 12:45:31 MDS9710 %USBHSD-2-MOUNT: logflash: online

Module 5: Waiting for module online.
-- SUCCESS
2025 Aug 27 12:50:50 MDS9710 %KERN-2-SYSTEM_MSG: [ 523.196775] Switchover started by redundancy driver
2025 Aug 27 12:50:50 MDS9710 %SYSMGR-2-HASWITCHOVER_PRE_START: This supervisor is becoming active (pre-
2025 Aug 27 12:50:50 MDS9710 %SYSMGR-2-HASWITCHOVER_START: Supervisor 5 is becoming active.
2025 Aug 27 12:50:51 MDS9710 %SYSMGR-2-SWITCHOVER_OVER: Switchover completed.
2025 Aug 27 12:50:54 MDS9710 %PLATFORM-1-PFM_ALERT: Disabling ejector based shutdown on sup in slot 5
2025 Aug 27 12:50:55 MDS9710 %IVR-2-IVR_NAT_INFO: Only IVR NAT is supported on this platform in this NX
2025 Aug 27 12:55:17 MDS9710 %USBHSD-STANDBY-2-MOUNT: logflash: online
2025 Aug 27 12:55:17 MDS9710 %USBHSD-STANDBY-2-MOUNT: slot0: online
```

```
2025 Aug 27 12:58:49 MDS9710 %PLATFORM-1-PFM_ALERT: Enabling ejector based shutdown on sup in slot 6


Module 1: Non-disruptive upgrading.
[# ] 0%2025 Aug 27 12:59:45 MDS9710 %PLATFORM-1-PFM_ALERT: Enabling ejector based shutdown on sup in sl
2025 Aug 27 13:00:33 MDS9710 %MODULE-2-MOD_EOL_WARN: module 1 (DS-X9448-768K9) is approaching End of Li
2025 Aug 27 13:00:43 MDS9710 %PMON-SLOT1-2-PMON_CRIT_INFO: Port Monitor Critical Information: Con[######


Module 4: Non-disruptive upgrading.
[# ] 0%2025 Aug 27 13:01:59 MDS9710 %MODULE-2-MOD_EOL_WARN: module 4 (DS-X9448-768K9) is approaching En
2025 Aug 27 13:02:08 MDS9710 %PMON-SLOT4-2-PMON_CRIT_INFO: Port Monitor Critical Information: Con[######


Module 8: Non-disruptive upgrading.
[# ] 0%2025 Aug 27 13:05:32 MDS9710 %PMON-SLOT8-2-PMON_CRIT_INFO: Port Monitor Critical Information: Co


Module 9: Non-disruptive upgrading.
[# ] 0%2025 Aug 27 13:10:19 MDS9710 %PMON-SLOT9-2-PMON_CRIT_INFO: Port Monitor Critical Information: Co


Module 10: Non-disruptive upgrading.
[# ] 0%2025 Aug 27 13:12:31 MDS9710 %PMON-SLOT10-2-PMON_CRIT_INFO: Port Monitor Critical Information: C

Install has been successful.
```

14.重新加载或安装EPLD for Fabric交换机。

- 32 Gbps交换矩阵交换机的具体准则：如果升级是在NX-OS 9.4(5)或更高版本之后且包含BIOS升级，请重新加载运行reload CLI命令的交换机。请勿运行reload system non-disruptive命令。
- 64 Gbps交换矩阵交换机的特定准则：激活64 Gbps交换矩阵交换机上的BIOS更新的机制已更改。新机制需要一次性中断交换机EPLD升级到IO FPGA版本或更高版本：

  表IO FPGA版本可实现无中断BIOS更新：

交换机	最低IO FPGA版本(IO SPI 2)
MDS 9124V	0.018
MDS 9148V	0.018
MDS 9396V	0.016

这些版本作为NX-OS 9.4(5)的一部分发布，可以在交换机运行NX-OS 9.4(5)（或更高版本）后安装。 运行install module 1 epld CLI命令升级EPLD。这包括交换机的自动中断性重新加载，以激活EPLD更新。如果EPLD未升级，则使用旧的重新加载机制，这会导致交换机在ISSU期间挂起，这包括BIOS更新。16 Gbps和32 Gbps交换矩阵交换机上不存在此功能。

更新EPLD后，后续ISSU可以激活映像中包含的任何新BIOS版本，而无需任何中断性重新加载。要确定当前EPLD版本，请运行show version module 1 epld命令。EPLD设备“IO SPI 2”是必须与上表

匹配的版本。

以下是MDS 9148V交换机的示例，显示“IO SPI 2”版本为0.013，该版本低于所需的0.018版本：

```
MDS9148V# show version module 1 epld

EPLD Device                     Version
------------------------------------
MI IO SPI                         0.011
IO SPI 2                          0.013
```

有关EPLD安装和更新的详细信息，请参阅MDS 9000系列EPLD固件版本9.4(5)的发行说明，其中包括所有MDS文档。

15.检验安装。

通过运行show version命令并注意系统和kickstart版本是预期版本，验证安装是否成功并完成：

```
MDS9124V# show version
Cisco Nexus Operating System (NX-OS) Software
TAC support: http://www.cisco.com/tac
Documents: http://www.cisco.com/en/US/products/ps9372/tsd_products_support_serie
s_home.html
Copyright (c) 2002-2025, Cisco Systems, Inc. All rights reserved.
The copyrights to certain works contained herein are owned by
other third parties and are used and distributed under license.
Some parts of this software are covered under the GNU Public
License. A copy of the license is available at
http://www.gnu.org/licenses/gpl.html.

Software
  BIOS:      version 1.11.0
  loader:    version N/A
  kickstart: version 9.4(3a)
  system:    version 9.4(3a)
  BIOS compile time:       11/27/2024
  kickstart image file is: bootflash:///m9124v-s8ek9-kickstart-mz.9.4.3a.bin
  kickstart compile time:  3/1/2025 12:00:00 [03/24/2025 22:26:25]
  system image file is:    bootflash:///m9124v-s8ek9-mz.9.4.3a.bin
  system compile time:     3/1/2025 12:00:00 [03/25/2025 00:13:28]


Hardware
  cisco MDS 9124V 24X64G FC (1 RU) Chassis ("24X8/16/32/64 Gbps FC/Sup-4")
  Intel(R) Xeon(R) CPU D-1633N @ 2.50GHz with 8053200 kB of memory.
  Processor Board ID JAE26220SYR

  Device name: F241-16-10-9124V-3
  bootflash:    7364608 kB
```

```
Kernel uptime is 0 day(s), 0 hour(s), 2 minute(s), 53 second(s)

Last reset at 356414 usecs after Fri Aug 22 20:22:16 2025
  Reason: Reset due to upgrade
  System version: 9.3(2a)
  Service:

plugin
  Core Plugin
MDS9124V#
```

在MDS 9700上，通过show module命令检验所有模块是否都处于正确的NX-OS级别：

```
MDS9710# show module
Mod  Ports  Module-Type                          Model              Status
---  -----  ----------------------------------- ------------------ ----------
1    48     2/4/8/10/16 Gbps Advanced FC Module DS-X9448-768K9     ok
4    48     2/4/8/10/16 Gbps Advanced FC Module DS-X9448-768K9     ok
5    0      Supervisor Module-4                 DS-X97-SF4-K9      active *
6    0      Supervisor Module-4                 DS-X97-SF4-K9      ha-standby
8    34     1/10/40G IPS,2/4/8/10/16G FC Module DS-X9334-K9        ok
9    48     4/8/16/32 Gbps Advanced FC Module   DS-X9648-1536K9    ok
10   48     8/16/32/64 Gbps Advanced FC Module  DS-X9748-3072K9    ok

Mod  Power-Status  Reason
---  ------------  ----------------------------
2    powered-dn     Configured Power down
3    powered-dn     Configured Power down

Mod  Sw               Hw
---  ---------------  ------
1    9.4(3a)          1.1
4    9.4(3a)          1.3
5    9.4(3a)          1.0
6    9.4(3a)          1.0
8    9.4(3a)          1.0
9    9.4(3a)          1.0
10   9.4(3a)          1.0
...
```

16.重新启用分析。

当无中断升级路径包括到最终目标版本的多个升级时，此步骤只能在上次NX-OS升级时完成。即升级到最终目标版本。完成到最终目标版本的升级后，如果在第7步中禁用了分析功能，现在即可重新启用它：

```
MDS9718# run before_issu_analytics.cfg
```

17.升级完成后，保存Show Tech-Support Details的副本。

```
mds9124V# tac-pac
Collecting show tech-support details...
Show tech details will take 4-8 minutes to complete. Please Wait ...
Collecting show logging onboard...
tacpac file volatile:mds9124V_tacpac_2025-08-22.gz created.
mds9124V#
```

18.将刚才保存的tac-pac/techsupport复制到TFTP服务器。

有关在安装之前安装到tac-pac的问题，您可以在安装之后与tac-pac进行比较。检查“move”命令，该命令重命名文件：

```
MDS9124V# move volatile:F241-16-10-9124V-3_tacpac_2025-08-22.gz volatile:F241-16-10-9124V-3_tacpac_2025
MDS9124V#
MDS9124V# copy volatile:F241-16-10-9124V-3_tacpac_2025-08-22_after_install.gz tftp://192.168.1.1
Trying to connect to tftp server......
Connection to server Established. Copying Started.....
-
TFTP put operation was successful
Copy complete.
MDS9124V#
```

关于此翻译
思科采用人工翻译与机器翻译相结合的方式将此文档翻译成不同语言，希望全球的用户都能通过各自的语言得到支持性的内容。

请注意：即使是最好的机器翻译，其准确度也不及专业翻译人员的水平。

Cisco Systems, Inc. 对于翻译的准确性不承担任何责任，并建议您总是参考英文原始文档（已提供链接）。